



MONUMENT TABLE

MON. NUMBER	NAVD88 ELEV.	MLLW ELEV.	ELEV. TAKEN AT:	ORIG. SET REF.	RESET REF.	REF. NOT SHOWN ON (48) OR (52)
M-1	10.27	9.98	DISC	(2)	(48)	
M-2	10.13	9.84	DISC	(2)	(48)	
M-3	9.67	9.38	DISC	(2)	(48)	
M-4	10.96	10.67	DISC	(2)	(48)	
M-5	10.09	9.80	DISC	(1)	(48)	
M-6	10.25	9.96	DISC	(1)	(48)	
M-7	10.11	9.82	DISC	(1)	(48)	
M-8	8.62	8.33	DISC	(1)	(48)	
M-9	9.04	8.75	DISC	(1)	(48)	
M-10	11.88	11.59	DISC	(2)	(48)	
M-11	11.70	11.41	DISC	(2)	(48)	
M-12	12.08	11.79	DISC	(2)	(48)	
M-13	12.01	11.72	DISC	(2)	(48)	
M-14	11.72	11.43	DISC	(2)	(48)	
M-15	11.47	11.18	DISC	(2)	(48)	(49)
M-16	11.86	11.57	DISC	(4)	(48)	(49) (50) (51)
M-17	8.33	8.04	Top of Pin	(1)	N/A	
M-18	11.69	11.40	DISC	(1)	(48)	(49) (51)
M-19	10.04	9.75	Top of Pin	(1)	N/A	
M-20	11.95	11.66	DISC	(4)	(52)	(4) (12) (26) (27) (28) (32) (33) (34) (40) (41) (44) (45) (52)
M-21	11.79	11.50	DISC	(4)	(52)	(4) (32) (34) (36) (40) (41) (42) (43) (44) (45)

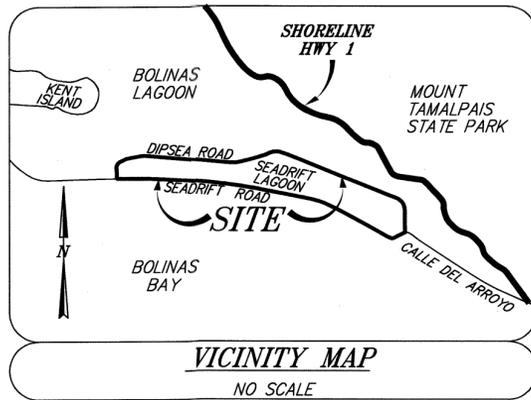

COUNTY SURVEYOR'S NOTE:
 PURSUANT TO BUSINESS AND PROFESSIONS CODE, SECTION 8768, IT IS THE OPINION OF THE COUNTY SURVEYOR THAT THIS MAP DOES NOT DEMONSTRATE HOW THE SURVEYOR REFERENCED SOME OF THE PREVIOUSLY EXISTING MONUMENTS SHOWN HEREON PRIOR TO THEIR REPLACEMENT, AND MONUMENTS THAT WERE REPLACED SHOULD HAVE BEEN TIED TO MULTIPLE REFERENCE POINTS PRIOR TO SAID MONUMENTS REMOVAL. INFORMATION WAS PROVIDED TO THIS OFFICE THAT SHOWS SINGLE TIES FROM SOME OF THE ORIGINAL MONUMENTS TO THE SURVEYOR'S CONTROL POINTS, AND SOME OF THESE CONTROL POINTS HAVE BEEN REMOVED FROM THIS MAP AS THEY WERE NOT TAGGED WITH THE ENGINEER'S LICENSE NUMBER, SAID CONTROL POINTS IN SOME INSTANCES BEING THE ONLY REFERENCE THAT EXISTED AFTER THE ORIGINAL MONUMENTS HAD BEEN REMOVED.

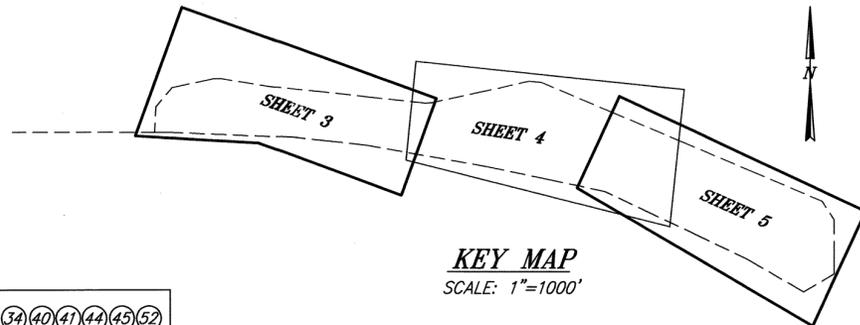

NOTES

- ALL DISTANCES AND ELEVATIONS ARE IN FEET AND DECIMALS THEREOF.
- ALL REFERENCES ARE FROM MARIN COUNTY RECORDS.
- MONUMENTS M-1 THROUGH M-16 & M-18 WERE REPLACED BY ILS ASSOC., PER 2015 RS 38 (REF#48). M-17 & M-19 WERE LEFT AS FOUND AND SHOWN ON SAID MAP. DUE TO A MISCUE WITH CONTRACTOR, MONUMENTS M-20 THROUGH M-23 WERE DESTROYED BY CONTRACTOR AND WERE NEVER LOCATED DIRECTLY BY ILS. MONUMENTS M-20 AND M-21 WERE REPLACED BY ILS PER 2017 RS 25 (REF#52) AND REFERENCED BOUNDARY CONTROL IS SHOWN ON PLAN AND DETAIL A ON SHEET 3. MONUMENT M-22 WAS REPLACED BY REFERENCE TO BOUNDARY CONTROL FROM R46 AS SHOWN ON PLAN AND DETAIL B ON SHEET 3. MONUMENT M-23 WAS REPLACED BY REFERENCE TO BOUNDARY CONTROL FROM R36 AS SHOWN ON PLAN, SHEET 4. MONUMENTS M-24 THROUGH M-30 WERE REPLACED IN THIS SURVEY. MONUMENT M-31 WAS SURVEYED, LEFT AS FOUND, AND SHOWN ON THIS SURVEY. SEE SURVEY NOTE, SHEET 3, FOR TRAVERSE CLOSURE INFORMATION.
- ADDITIONAL REFERENCES NOT LISTED ON REF#'S 48 & 52 FOR MONUMENTS M-1 THROUGH M-21, ON WHICH MONUMENTS ARE SHOWN, ARE LISTED IN MONUMENT TABLE, THIS SHEET.

LOCALIZED SURVEYS CAN STILL UTILIZE LOCALIZED REFERENCE MAPS AND THE BASIS OF BEARINGS THEREON.

AS AN EXAMPLE, 2017 RS 25 ABOVE MENTIONED IS A BOUNDARY SURVEY UTILIZING 2011 RS 130 AS ITS BASIS OF BEARINGS AND AS A SOURCE OF CONTROL MEASUREMENTS TO REPLACE MONUMENTS M-20 & M-21.

- VERTICAL DATUM IS NAVD88 TAKEN FROM NGS BENCHMARK HT1718, A FOUND 3.5" BRASS DISC IN ROCK FORMATION NEXT TO STATE HIGHWAY 1 STAMPED "X480 1951". RECORD NAVD88 ELEVATION = 20.7 FEET. CONVERSION FORMULA FROM TIDAL BENCHMARK DATUMS FOR STATION 9414958, BOLINAS, BOLINAS LAGOON: 0.00 FEET NAVD88 (NORTH AMERICAN VERTICAL DATUM OF 1988) = -0.29 FEET MLLW (MEAN LOWER LOW WATER). SEE ELEVATIONS LISTED IN MONUMENT TABLE, THIS SHEET.
- COORDINATES AS SHOWN ARE BASED ON LOCAL GROUND LEVEL ASSUMED SYSTEM.
- INFORMATION FOR CONTROL/REFERENCE POINTS WITH PROPER TAG IDENTIFICATION SET TO COLLECT INITIAL LOCATIONS OF MONUMENTS AND STAKE MONUMENT REPLACEMENTS ARE SHOWN ON PLAN AND IN CONTROL TABLE ON SHEET 2.

SURVEYOR'S STATEMENT

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS OF THE PROFESSIONAL LAND SURVEYOR'S ACT AT THE REQUEST OF SEADRIFT ASSOCIATION IN JANUARY 2016.

Irving L. Schwartz 10.4.18
 IRVING L. SCHWARTZ R.C.E. 18221



SHEET INDEX

- SHEET 1 - STATEMENTS, NOTES, MONUMENT TABLE
- SHEET 2 - REFERENCE TABLE, INVERSE TABLE, CONTROL TABLE
- SHEET 3 - MAP SHEET, 1"=100'
- SHEET 4 - MAP SHEET, 1"=100'
- SHEET 5 - MAP SHEET, 1"=100'

COUNTY SURVEYOR'S STATEMENT

THIS MAP HAS BEEN EXAMINED IN ACCORDANCE WITH SECTION 8766 OF THE PROFESSIONAL LAND SURVEYOR'S ACT

THIS 10TH DAY OF OCTOBER 2018.

SIGNED: *Tracy W. Park*
 TRACY W. PARK, COUNTY SURVEYOR
 BY DEPUTY



RECORDER'S STATEMENT

FILED THIS 12 DAY OF October 2018 AT 8:01 AM
 IN BOOK 2018 OF MAPS AT PAGE 172
 AT THE REQUEST OF ILS ASSOCIATES, INC. AND THE DEPARTMENT OF PUBLIC WORKS.
 SERIAL NO. 2018-0035628 FEE: \$92.00

SIGNED: *Richard N. Benson*
 COUNTY RECORDER

SIGNED: *A.R. Subetto*
 DEPUTY

RECORD OF SURVEY
 SEADRIFT ROAD & DIPSEA ROAD
 MONUMENT REPLACEMENT AND CONTROL SURVEY
 STINSON BEACH
 MARIN COUNTY CALIFORNIA

ILS ASSOCIATES, INC.
 CIVIL ENGINEERING AND LAND SURVEYING

79 GALLI DRIVE, SUITE A NOVATO, CA 94949-5717 (415)883-9200 FAX (415)883-2763
 AP BOOK 195, PAGES -03,-04,-05,
 -07,-08,-09,-31,-32,-33 & -34 JOB NO. 9047 OCTOBER 2018 SHEET 1 OF 5

MON. NUMBER	NAVD88 ELEV.	MLLW ELEV.	ELEV. TAKEN AT:	ORIG. SET REF.	RESET REF.	ORIGINAL MONUMENT DESCRIPTION	RESET DESCRIPTION	REF# WHERE MONUMENT IS SHOWN	DATE NEW BRASS DISC WAS PUNCHED BY ILS
M-22	11.07	10.78	DISC	(2)	THIS MAP	DESTROYED DURING ROAD RECONSTRUCTION, RESET PER (46) (SEE NOTE 3 THIS SHEET)	2" BRASS DISC STAMPED "M-22 RCE 18221", WITH PUNCH MARK, IN NEW WELL CASE	(2) (3) (7) (8) (9) (10) (46)	JUNE 30, 2016
M-23	12.00	11.71	DISC	(1)	THIS MAP	DESTROYED DURING ROAD RECONSTRUCTION, RESET PER (36) (SEE NOTE 3 THIS SHEET)	2" BRASS DISC STAMPED "M-23 RCE 18221", WITH PUNCH MARK, IN NEW WELL CASE	(1) (4) (36) (42) (43)	JUNE 30, 2016
M-24	11.54	11.25	DISC	(2)	THIS MAP	FOUND 2" IRON PIPE WITH PIN AND BRASS TAG STAMPED "RE 10057", IN CONCRETE, IN WELL CASE	2" BRASS DISC STAMPED "M-24 RCE 18221", WITH PUNCH MARK, IN NEW WELL CASE	(2) (3) (8) (10) (46)	JUNE 28, 2016
M-25	11.77	11.48	DISC	(2)	THIS MAP	FOUND 2" IRON PIPE WITH PIN AND BRASS TAG STAMPED "RE 10057", IN CONCRETE, IN WELL CASE	2" BRASS DISC STAMPED "M-25 RCE 18221", WITH PUNCH MARK, IN NEW WELL CASE	(2) (3) (8) (10) (25)	JUNE 28, 2016
M-26	12.40	12.11	DISC	(2)	THIS MAP	FOUND 2" IRON PIPE WITH PIN AND BRASS TAG STAMPED "RE 10057", IN CONCRETE, IN WELL CASE	2" BRASS DISC STAMPED "M-26 RCE 18221", WITH PUNCH MARK, IN NEW WELL CASE	(2) (8) (26)	JUNE 28, 2016
M-27	11.37	11.08	DISC	(2)	THIS MAP	FOUND 2" IRON PIPE WITH PIN AND BRASS TAG STAMPED "RE 10057", IN CONCRETE, IN WELL CASE	2" BRASS DISC STAMPED "M-27 RCE 18221", WITH PUNCH MARK, IN NEW WELL CASE	(2) (3) (8) (10) (26)	JUNE 28, 2016
M-28	10.76	10.47	DISC	(2)	THIS MAP	FOUND 2" IRON PIPE WITH PIN AND BRASS TAG STAMPED "RE 10057", IN CONCRETE, IN WELL CASE	2" BRASS DISC STAMPED "M-28 RCE 18221", WITH PUNCH MARK, IN NEW WELL CASE	(2) (3) (8) (10) (29)	JUNE 28, 2016
M-29	11.96	11.67	DISC	(2)	THIS MAP	FOUND 2" IRON PIPE WITH PIN AND BRASS TAG STAMPED "RE 10057", IN CONCRETE, IN WELL CASE	2" BRASS DISC STAMPED "M-29 RCE 18221", WITH PUNCH MARK, IN NEW WELL CASE	(2) (3) (8) (10) (29) (31)	JUNE 28, 2016
M-30	11.79	11.50	DISC	(2)	THIS MAP	FOUND 2" IRON PIPE WITH PIN AND BRASS TAG STAMPED "RE 10057", IN CONCRETE, IN WELL CASE	2" BRASS DISC STAMPED "M-30 RCE 18221", WITH PUNCH MARK, IN NEW WELL CASE	(2) (3) (8) (10) (29) (31)	JUNE 28, 2016
M-31	10.79	10.50	Top of Pin	(4)	N/A	FOUND PIN IN CONCRETE, NO TAG, IN WELL CASE	NOT RESET, LEFT AS FOUND	(4) (47) (49) (50) (51)	SHOT AUG. 24, 2016

REFERENCE TABLE

REF#	RECORD INFORMATION
1	10 RM 95 / MAP OF SEADRIFT LAGOON SUBDIVISION NO. ONE
2	11 RM 51 / MAP OF SEADRIFT LAGOON SUBDIVISION NO. TWO
3	19 RM 80 / MAP OF RESUBDIVISION OF PORTIONS OF SEADRIFT LAGOON SUBDIVISION NO. ONE & NO. TWO
4	9 RM 62 / MAP OF SEADRIFT SUBDIVISION NO. TWO
5	20 RM 8 / MAP OF NORMAN'S SEADRIFT SUBDIVISION
6	18 PM 33 / PARCEL MAP/ LANDS OF SCHWEITZER
7	19 PM 43 / PARCEL MAP/ LANDS OF ROGER EDWARD PARKS
8	23 PM 25 / PARCEL MAP/ LANDS OF ROUMI GUIERE et al
9	18 OS 38 / RECORD OF SURVEY/ LANDS OF BORCHERDING
10	22 OS 33 / RECORD OF SURVEY/ RE-SURVEY PORTIONS OF 19 RM 80 AND 11 RM 51
11	98 RS 44 / RECORD OF SURVEY/ LOT LINE ADJUSTMENT, LANDS OF BRADY
12	2005 RS 354 / RECORD OF SURVEY/ LANDS OF SEBASTIANI
13	2007 RS 159 / RECORD OF SURVEY/ LANDS OF MINER
14	CORNER RECORD FOR APN 195-031-10, FILED APRIL 17, 2002
15	CORNER RECORD FOR APN 195-031-14,-15, FILED MAY 14, 2013
16	CORNER RECORD FOR APN 195-041-04, FILED JANUARY 8, 2002
17	CORNER RECORD FOR APN 195-041-04, FILED SEPTEMBER 12, 2007
18	CORNER RECORD FOR APN 195-041-14, FILED APRIL 6, 2010
19	CORNER RECORD FOR APN 195-041-25, FILED NOVEMBER 17, 2004
20	CORNER RECORD FOR APN 195-041-25, FILED AUGUST 26, 2009
21	CORNER RECORD FOR APN 195-041-26, FILED MARCH 20, 2008
22	CORNER RECORD FOR APN 195-041-27, FILED AUGUST 7, 2006
23	CORNER RECORD FOR APN 195-041-37, FILED JULY 5, 2012
24	CORNER RECORD FOR APN 195-320-41,-42, FILED SEPTEMBER 25, 2006
25	CORNER RECORD FOR APN 195-320-79, FILED JUNE 25, 2014
26	CORNER RECORD FOR APN 195-340-74, FILED APRIL 5, 2006
27	CORNER RECORD FOR APN 195-340-40,-75, FILED JULY 22, 1998
28	18 PM 8 / PARCEL MAP / LANDS OF SETRAKIAN
29	19 PM 85 / PARCEL MAP / LANDS OF CLARENCE H. WHITBECK
30	20 PM 61 / PARCEL MAP / LANDS OF JENCKS
31	20 PM 97 / PARCEL MAP / LANDS OF GRANT
32	1998 RS 76 / RECORD OF SURVEY / LANDS OF BRIGGS & SKINNER
33	2008 RS 77 / RECORD OF SURVEY/ LANDS OF SHARP
34	2011 RS 130 / RECORD OF SURVEY / LANDS OF BAUMAN TRUST & WALKER III TRUST
35	2014 RS 116 / RECORD OF SURVEY/ LANDS OF GARDNER
36	2015 RS 21 / RECORD OF SURVEY/ LANDS OF SCHWEITZER & RUPPE
37	CORNER RECORD / APN 195-090-48 FILED APRIL 9, 1997
38	CORNER RECORD / APN 195-090-49 FILED APRIL 9, 1997
39	CORNER RECORD / APN 195-090-48,49 FILED APRIL 9, 1997
40	CORNER RECORD / APN 195-331-20 FILED NOV. 21, 2013
41	CORNER RECORD / APN 195-331-21, FILED JULY 18, 2006
42	CORNER RECORD / APN 195-331-35, FILED SEPT. 9, 2009
43	CORNER RECORD / APN 195-331-39, FILED FEB. 13, 2014
44	CORNER RECORD / APN 195-340-43, FILED JUNE 14, 2013
45	CORNER RECORD / APN 195-340-44, FILED APRIL 20, 2011
46	CORNER RECORD / APN 195-340-52, FILED SEPT. 25, 2006
47	CORNER RECORD / APN 195-310-18, FILED APRIL 24, 2008
48	2015 RS 38 / RECORD OF SURVEY / MON. REPLACEMENT
49	12 RM 90 / MAP OF SEADRIFT SUBDIVISION NO. THREE
50	2007 RS 82 / RECORD OF SURVEY / LANDS OF WERNER
51	2009 RS 83 / RECORD OF SURVEY / LANDS OF WINSLOW
52	2017 RS 25 / RECORD OF SURVEY / LANDS OF COATES TRUST

MONUMENT INVERSE TABLE


POINT	NORTHING	EASTING	COURSE	DISTANCE
M-4	4,663.1787	15,198.2946		
			S 67° 06' 43" E	646.582
M-3	4,411.7009	15,793.9684		
			S 33° 33' 11" E	193.422
M-2	4,250.5080	15,900.8749		
			S 00° 00' 30" E	309.898
M-1	3,940.6103	15,900.9198		
			S 00° 00' 33" E	159.075
M-17	3,781.5351	15,900.9454		
			S 60° 06' 19" W	307.035
M-19	3,628.5065	15,634.7638		
			N 59° 52' 00" W	561.269
M-5	3,910.2713	15,149.3454		
			N 64° 37' 08" W	483.334
M-6	4,117.4458	14,712.6637		
			N 64° 38' 19" W	480.075
M-7	4,323.0748	14,278.8568		
			N 64° 37' 56" W	401.683
M-8	4,495.1676	13,915.9056		
			N 78° 07' 53" W	490.229
M-9	4,595.9932	13,436.1571		
			N 78° 07' 53" W	548.580
M-23	4,708.8199	12,899.3050		
			N 80° 00' 21" W	1,051.802
M-21	4,891.3594	11,863.4638		
			N 83° 51' 53" W	646.750
M-20	4,960.4801	11,220.4181		
			N 87° 17' 59" W	1,087.501
M-16	5,011.7127	10,134.1250		
			N 89° 56' 40" W	105.368
M-18	5,011.8148	10,028.7567		
			N 02° 41' 20" E	219.767
M-15	5,231.3401	10,039.0662		
			N 40° 25' 25" E	214.138
M-14	5,394.3575	10,177.9208		
			N 78° 08' 37" E	364.796
M-13	5,469.3082	10,534.9338		
			N 88° 49' 47" E	64.927
M-12	5,470.6343	10,599.8473		
			S 80° 26' 54" E	440.883
M-11	5,397.4745	11,034.6179		
			S 83° 53' 26" E	419.337
M-10	5,352.8448	11,451.5730		
			S 83° 52' 21" E	420.095
M-22	5,308.0033	11,869.2675		
			S 83° 52' 47" E	502.290
M-24	5,254.4521	12,368.6951		
			N 86° 50' 57" E	56.307
M-25	5,257.5471	12,424.9166		
			N 77° 37' 22" E	436.049
M-26	5,351.0120	12,850.8307		
			N 77° 35' 27" E	427.038
M-27	5,442.7793	13,267.8916		
			S 84° 45' 47" E	106.085
M-28	5,433.0967	13,373.5334		
			S 67° 07' 39" E	660.177
M-29	5,176.4966	13,981.8011		
			S 67° 07' 18" E	660.119
M-30	4,919.8588	14,589.9906		
			S 67° 07' 20" E	660.241
M-4	4,663.1787	15,198.2946		
M-18	5,011.8148	10,028.7567		
			N 89° 56' 52" W	1228.181'
M-31	5,012.9363	8800.5762		

CONTROL TABLE

POINT	NORTHING	EASTING	NAVD88 ELEVATION	DESCRIPTION
101	5,011.4249	10,453.1937	11.95	REBAR+RED CAP "CONTROL RCE 18221"
103	5,443.0134	10,342.7803	11.98	REBAR+RED CAP "CONTROL RCE 18221"
104	5,479.1836	10,644.7513	11.93	REBAR+RED CAP "CONTROL RCE 18221"
105	5,391.8492	10,967.1775	11.62	REBAR+RED CAP "CONTROL RCE 18221"
106	5,511.7137	10,667.2081	12.95	REBAR+RED CAP "CONTROL RCE 18221"
107	5,412.7102	11,298.3458	11.15	REBAR+RED CAP "CONTROL RCE 18221"
108	5,374.1223	11,659.1422	10.85	REBAR+RED CAP "CONTROL RCE 18221"
109	5,322.0722	12,073.9250	10.55	REBAR+RED CAP "CONTROL RCE 18221"
110	5,291.3975	12,478.6498	12.02	REBAR+RED CAP "CONTROL RCE 18221"
111	5,378.2195	12,835.6591	12.53	REBAR+RED CAP "CONTROL RCE 18221"
112	5,431.4073	13,108.3121	12.54	REBAR+RED CAP "CONTROL RCE 18221"
116	4,895.4476	14,622.9140	11.96	BOD NAIL+DOUBLE WASHER "CONTROL RCE 18221"
118	4,547.1470	15,513.6767	11.82	REBAR+RED CAP "CONTROL RCE 18221"
121	3,748.5694	15,874.4960	8.93	NAIL+DOUBLE WASHER "CONTROL RCE 18221"
123	3,843.0891	15,303.9617	10.30	REBAR+RED CAP "CONTROL RCE 18221"
130	4,738.5069	12,647.1398	12.60	REBAR+RED CAP "CONTROL RCE 18221"
135	5,006.2237	10,597.5031	11.81	REBAR+RED CAP "CONTROL RCE 18221"
138	3,736.4202	15,861.2906	8.89	NAIL+DOUBLE WASHER "CONTROL RCE 18221"
140	4,671.1500	13,145.9288	10.44	NAIL+DOUBLE WASHER "CONTROL RCE 18221"
142	4,959.5040	11,303.7618	12.40	NAIL+DOUBLE WASHER "CONTROL RCE 18221"
143	4,908.9231	11,608.1010	12.53	NAIL+DOUBLE WASHER "CONTROL RCE 18221"
144	4,968.7406	10,879.1744	12.28	NAIL+DOUBLE WASHER "CONTROL RCE 18221"
147	5,020.3454	9,728.6614	11.50	NAIL+DOUBLE WASHER "CONTROL RCE 18221"
148	5,007.1809	9,429.4660	11.38	NAIL+DOUBLE WASHER "CONTROL RCE 18221"
149	5,019.9709	9,096.3291	11.72	NAIL+DOUBLE WASHER "CONTROL RCE 18221"


RECORD OF SURVEY
SEADRIFT ROAD & DIPSEA ROAD
MONUMENT REPLACEMENT AND CONTROL SURVEY
STINSON BEACH
MARIN COUNTY CALIFORNIA



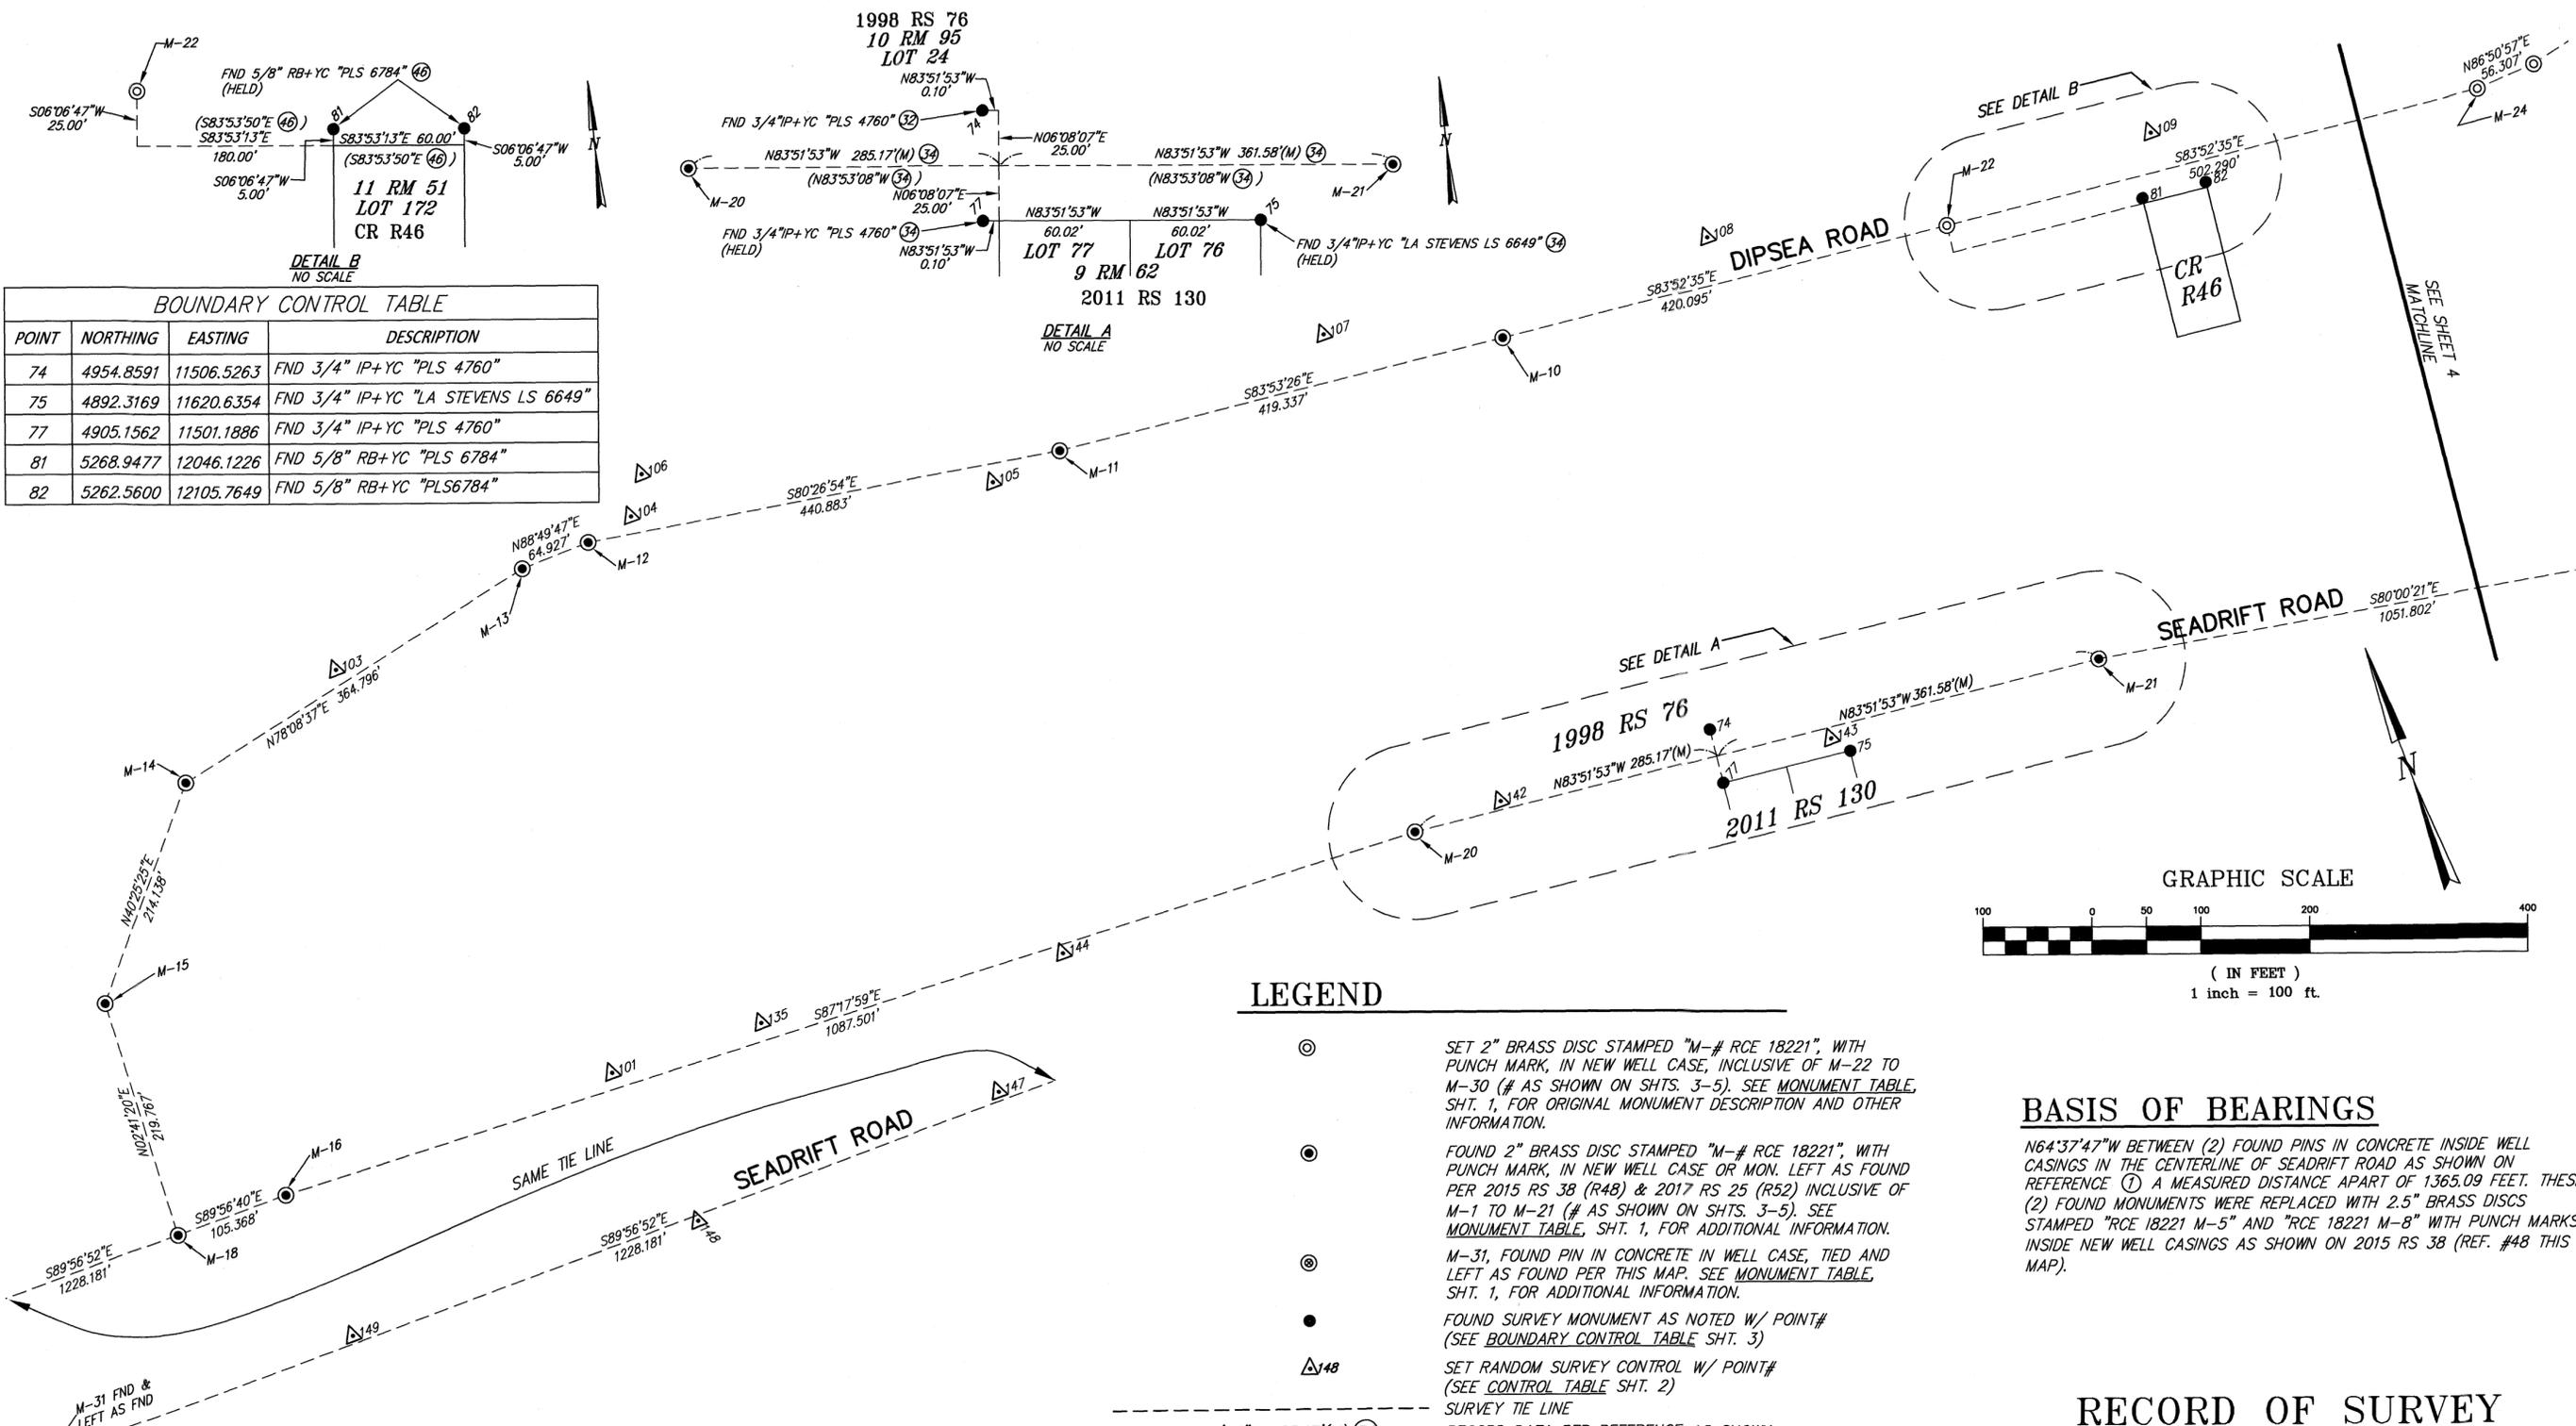

BOUNDARY CONTROL TABLE

POINT	NORTHING	EASTING	DESCRIPTION
74	4954.8591	11506.5263	FND 3/4" IP+YC "PLS 4760"
75	4892.3169	11620.6354	FND 3/4" IP+YC "LA STEVENS LS 6649"
77	4905.1562	11501.1886	FND 3/4" IP+YC "PLS 4760"
81	5268.9477	12046.1226	FND 5/8" RB+YC "PLS 6784"
82	5262.5600	12105.7649	FND 5/8" RB+YC "PLS 6784"

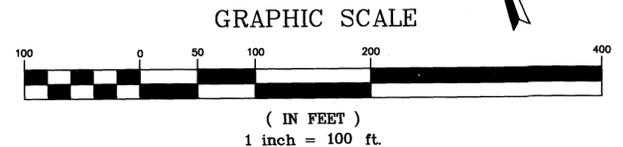

LEGEND

- ⊙ SET 2" BRASS DISC STAMPED "M-# RCE 18221", WITH PUNCH MARK, IN NEW WELL CASE, INCLUSIVE OF M-22 TO M-30 (# AS SHOWN ON SHTS. 3-5). SEE MONUMENT TABLE, SHT. 1, FOR ORIGINAL MONUMENT DESCRIPTION AND OTHER INFORMATION.
- FOUND 2" BRASS DISC STAMPED "M-# RCE 18221", WITH PUNCH MARK, IN NEW WELL CASE OR MON. LEFT AS FOUND PER 2015 RS 38 (R48) & 2017 RS 25 (R52) INCLUSIVE OF M-1 TO M-21 (# AS SHOWN ON SHTS. 3-5). SEE MONUMENT TABLE, SHT. 1, FOR ADDITIONAL INFORMATION.
- ⊙ M-31, FOUND PIN IN CONCRETE IN WELL CASE, TIED AND LEFT AS FOUND PER THIS MAP. SEE MONUMENT TABLE, SHT. 1, FOR ADDITIONAL INFORMATION.
- FOUND SURVEY MONUMENT AS NOTED W/ POINT# (SEE BOUNDARY CONTROL TABLE SHT. 3)
- ⊙ SET RANDOM SURVEY CONTROL W/ POINT# (SEE CONTROL TABLE SHT. 2)
- SURVEY TIE LINE
RECORD DATA PER REFERENCE AS SHOWN
RECORD DATA DIFFERS FROM MEASURED PER REFERENCE AS SHOWN

BASIS OF BEARINGS

N64°37'47"W BETWEEN (2) FOUND PINS IN CONCRETE INSIDE WELL CASINGS IN THE CENTERLINE OF SEADRIFT ROAD AS SHOWN ON REFERENCE (1) A MEASURED DISTANCE APART OF 1365.09 FEET. THESE (2) FOUND MONUMENTS WERE REPLACED WITH 2.5" BRASS DISCS STAMPED "RCE 18221 M-5" AND "RCE 18221 M-8" WITH PUNCH MARKS INSIDE NEW WELL CASINGS AS SHOWN ON 2015 RS 38 (REF. #48 THIS MAP).

SURVEY NOTE

SINCE THE TIME WHEN THESE MONUMENTS WERE ALL SET NO RE-SURVEY OF THE COMPLETE CONTROL LOOP EXISTS. WE PERFORMED A CLOSED GROUND TRAVERSE AROUND THE FULL LOOP OF SEADRIFT ROAD AND DIPSEA ROAD OVER A DISTANCE OF 13226.39 FEET WITH A HORIZONTAL ERROR OF CLOSURE OF 0.68' (PRIMARILY ANGULAR) WHICH RELATES TO A POINT CLOSURE OF CLOSE TO 1:20000 WHICH IS A "SECOND ORDER CLASS II" CLASSIFICATION. A LEAST SQUARES ADJUSTMENT WAS PERFORMED ON THIS CLOSED TRAVERSE INCLUSIVE OF REDUNDANT CONTROL CROSS-TIES AND ALL SIDE TIES UTILIZING THE COMPUTER PROGRAM FROM Microsurvey: STAR*NET-PRO Version 8. ALL LISTED COORDINATES REFLECT THIS TRAVERSE/SIDE SHOT ADJUSTMENT. THEREFORE, DUE TO THE OVERALL ADJUSTMENT OF COORDINATES BEFORE MONUMENTS WERE RESET, THE MONUMENTS MAY NOT BE IN THEIR EXACT ORIGINAL LOCATION BY DISTANCES UP TO APPROXIMATELY 0.015' PER MONUMENT. SEE NOTES 3 & 4, SHEET 1, FOR ADDITIONAL CLARIFICATION.


RECORD OF SURVEY
SEADRIFT ROAD & DIPSEA ROAD
MONUMENT REPLACEMENT AND CONTROL SURVEY

STINSON BEACH
MARIN COUNTY CALIFORNIA


ILS ASSOCIATES, INC.®
CIVIL ENGINEERING AND LAND SURVEYING

79 GALLI DRIVE, SUITE A NOVATO, CA 94949-5717 (415)883-9200 FAX (415)883-2763
AP BOOK 195, PAGES -03,-04,-05, -07,-08,-09,-31,-32,-33 & -34 JOB NO. 9047 OCTOBER 2018 SHEET 3 OF 5

GRAPHIC SCALE

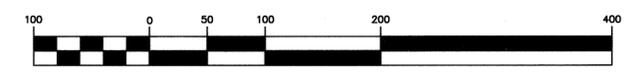

(IN FEET)
1 inch = 100 ft.

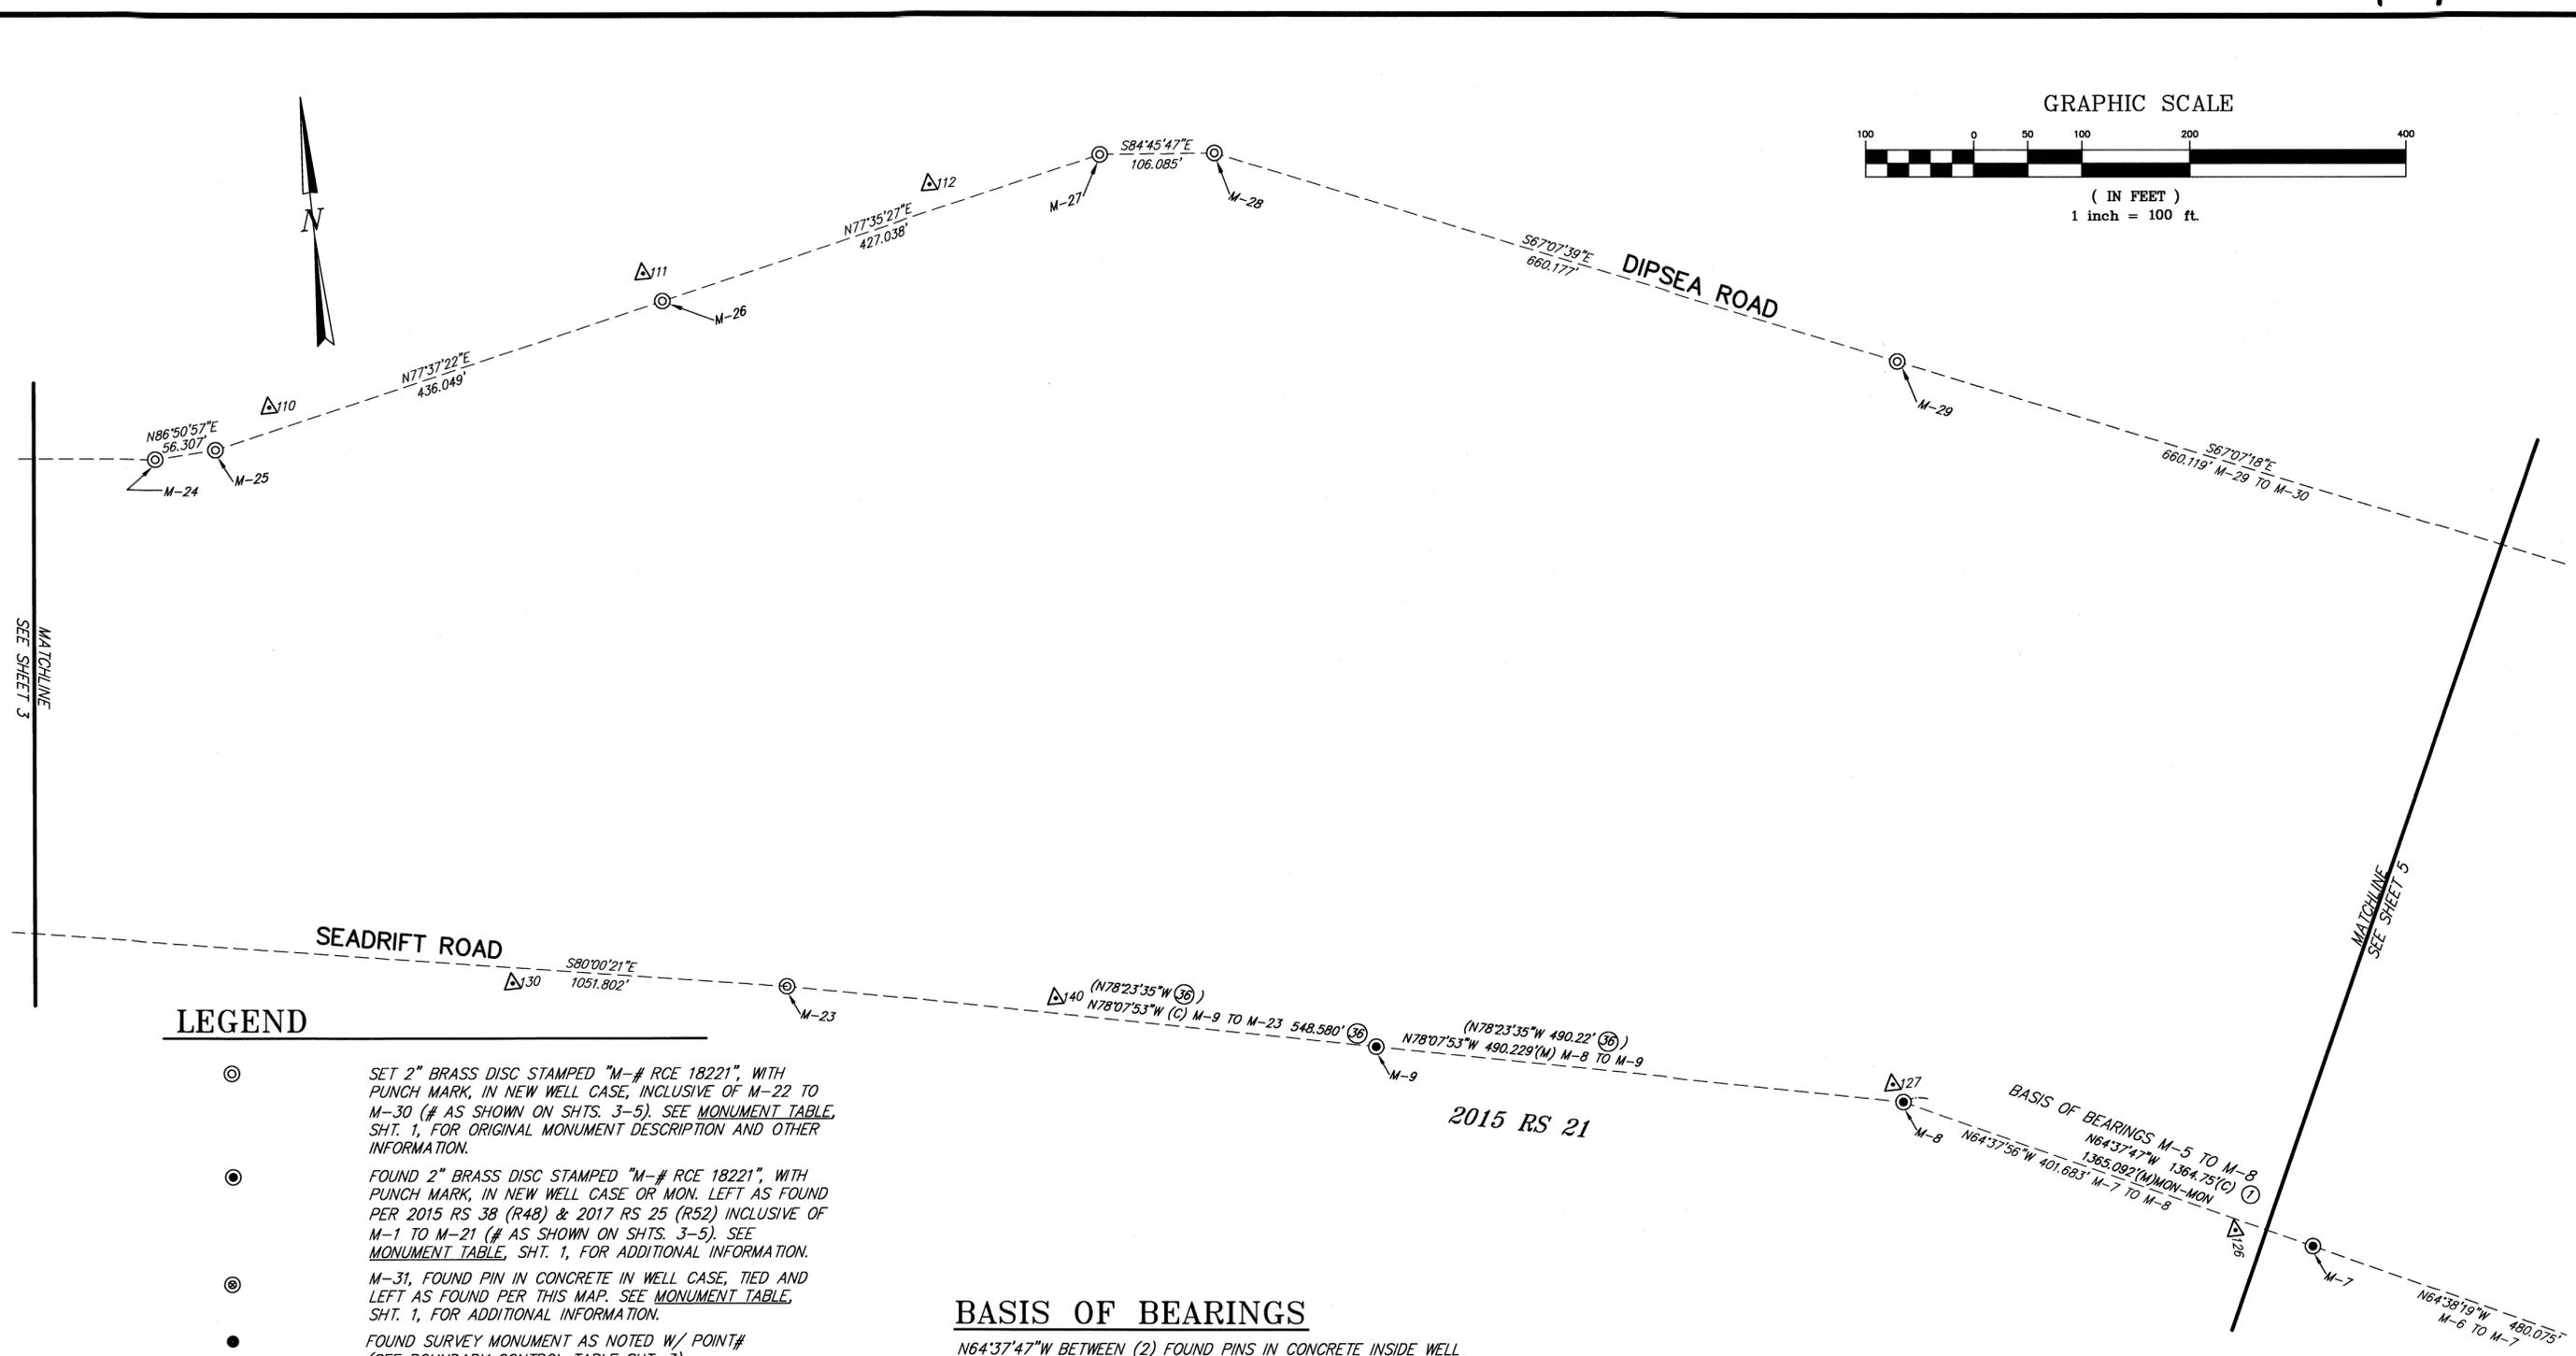

LEGEND

- ⊙ SET 2" BRASS DISC STAMPED "M-# RCE 18221", WITH PUNCH MARK, IN NEW WELL CASE, INCLUSIVE OF M-22 TO M-30 (# AS SHOWN ON SHTS. 3-5). SEE MONUMENT TABLE, SHT. 1, FOR ORIGINAL MONUMENT DESCRIPTION AND OTHER INFORMATION.
- ⊙ FOUND 2" BRASS DISC STAMPED "M-# RCE 18221", WITH PUNCH MARK, IN NEW WELL CASE OR MON. LEFT AS FOUND PER 2015 RS 38 (R48) & 2017 RS 25 (R52) INCLUSIVE OF M-1 TO M-21 (# AS SHOWN ON SHTS. 3-5). SEE MONUMENT TABLE, SHT. 1, FOR ADDITIONAL INFORMATION.
- ⊙ M-31, FOUND PIN IN CONCRETE IN WELL CASE, TIED AND LEFT AS FOUND PER THIS MAP. SEE MONUMENT TABLE, SHT. 1, FOR ADDITIONAL INFORMATION.
- FOUND SURVEY MONUMENT AS NOTED W/ POINT# (SEE BOUNDARY CONTROL TABLE SHT. 3)
- △48 SET RANDOM SURVEY CONTROL W/ POINT# (SEE CONTROL TABLE SHT. 2)
- SURVEY TIE LINE
- N83°51'53"W 285.17'(M) (34)
(239.20' (3)) RECORD DATA PER REFERENCE AS SHOWN
RECORD DATA DIFFERS FROM MEASURED PER REFERENCE AS SHOWN
- (C) CALCULATED DATA
- (M) MEASURED DATA
- PM PUNCH MARK
- FND FOUND
- IP IRON PIPE
- RB REBAR
- YC YELLOW CAP, STAMPED AS NOTED
- CR CORNER RECORD
- CONC. CONCRETE
- BT BRASS TAG, STAMPED AS NOTED
- N NAIL
- MON MONUMENT

BASIS OF BEARINGS


N64°37'47"W BETWEEN (2) FOUND PINS IN CONCRETE INSIDE WELL CASINGS IN THE CENTERLINE OF SEADRIFT ROAD AS SHOWN ON REFERENCE ① A MEASURED DISTANCE APART OF 1365.09 FEET. THESE (2) FOUND MONUMENTS WERE REPLACED WITH 2.5" BRASS DISCS STAMPED "RCE 18221 M-5" AND "RCE 18221 M-8" WITH PUNCH MARKS INSIDE NEW WELL CASINGS AS SHOWN ON 2015 RS 38 (REF. #48 THIS MAP).

RECORD OF SURVEY
SEADRIFT ROAD & DIPSEA ROAD
MONUMENT REPLACEMENT AND CONTROL SURVEY

STINSON BEACH
MARIN COUNTY CALIFORNIA



79 GALLI DRIVE, SUITE A NOVATO, CA 94949-5717 (415)883-9200 FAX (415)883-2763
AP BOOK 195, PAGES -03,-04,-05,
-07,-08,-09,-31,-32,-33 & -34 JOB NO. 9047 OCTOBER 2018 SHEET 4 OF 5

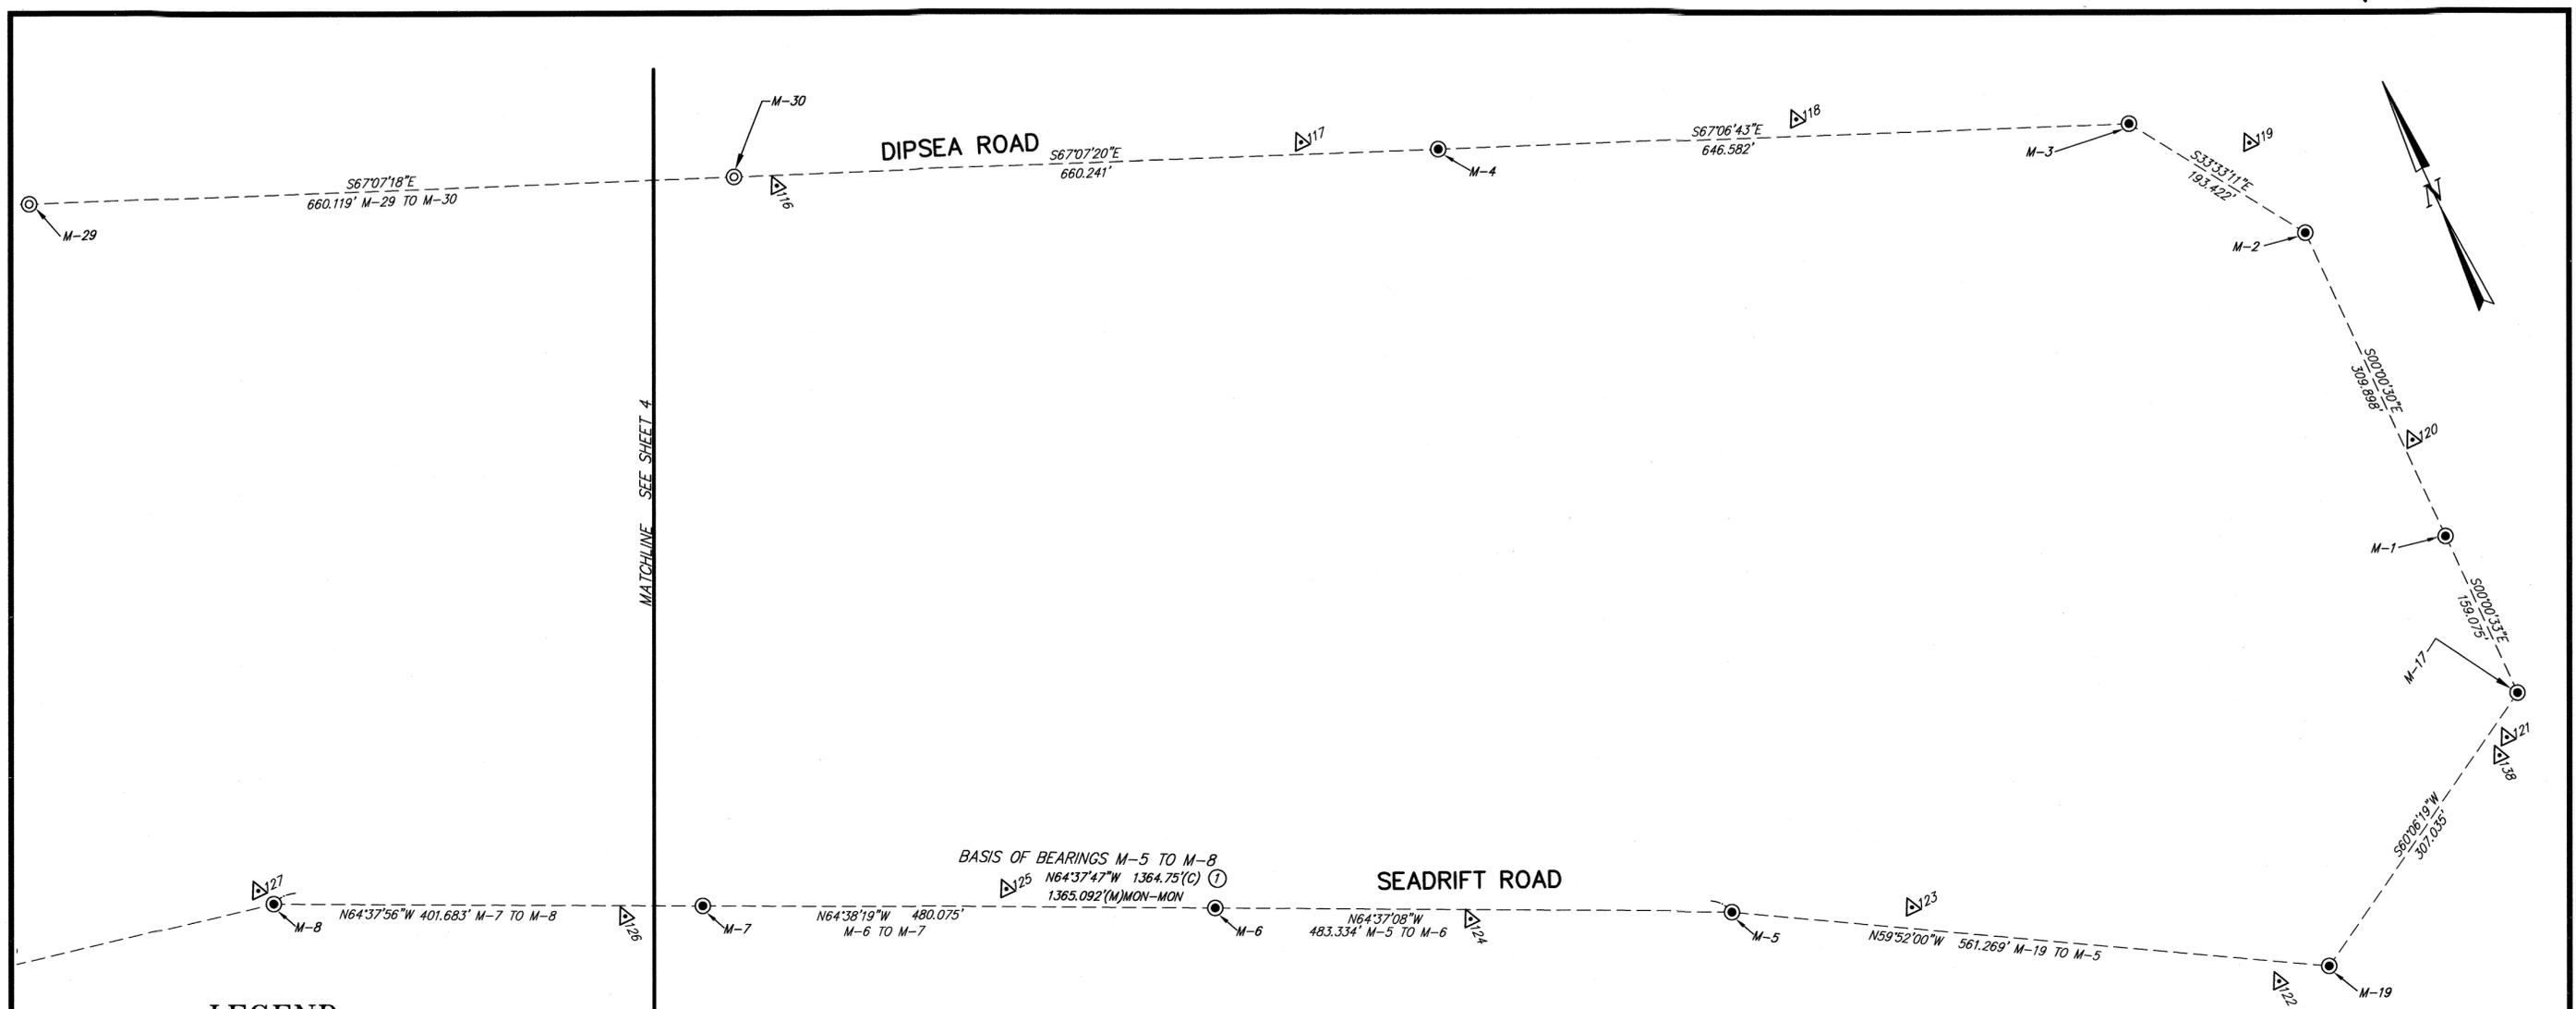


LEGEND

- ⊙ SET 2" BRASS DISC STAMPED "M-# RCE 18221", WITH PUNCH MARK, IN NEW WELL CASE, INCLUSIVE OF M-22 TO M-30 (# AS SHOWN ON SHTS. 3-5). SEE MONUMENT TABLE, SHT. 1, FOR ORIGINAL MONUMENT DESCRIPTION AND OTHER INFORMATION.
- FOUND 2" BRASS DISC STAMPED "M-# RCE 18221", WITH PUNCH MARK, IN NEW WELL CASE OR MON. LEFT AS FOUND PER 2015 RS 38 (R4B) & 2017 RS 25 (R52) INCLUSIVE OF M-1 TO M-21 (# AS SHOWN ON SHTS. 3-5). SEE MONUMENT TABLE, SHT. 1, FOR ADDITIONAL INFORMATION.
- ⊙ M-31, FOUND PIN IN CONCRETE IN WELL CASE, TIED AND LEFT AS FOUND PER THIS MAP. SEE MONUMENT TABLE, SHT. 1, FOR ADDITIONAL INFORMATION.
- FOUND SURVEY MONUMENT AS NOTED W/ POINT# (SEE BOUNDARY CONTROL TABLE SHT. 3)
- △#48 SET RANDOM SURVEY CONTROL W/ POINT# (SEE CONTROL TABLE SHT. 2)
- SURVEY TIE LINE
- N83°51'53"W 285.17'(M) (34) RECORD DATA PER REFERENCE AS SHOWN
- (239.20' (3)) RECORD DATA DIFFERS FROM MEASURED PER REFERENCE AS SHOWN
- (C) CALCULATED DATA
- (M) MEASURED DATA
- PM PUNCH MARK
- FND FOUND
- IP IRON PIPE
- RB REBAR
- YC YELLOW CAP, STAMPED AS NOTED
- CR CORNER RECORD
- CONC. CONCRETE
- BT BRASS TAG, STAMPED AS NOTED
- N NAIL
- MON MONUMENT

BASIS OF BEARINGS

N64°37'47"W BETWEEN (2) FOUND PINS IN CONCRETE INSIDE WELL CASINGS IN THE CENTERLINE OF SEADRIFT ROAD AS SHOWN ON REFERENCE ① A MEASURED DISTANCE APART OF 1365.09 FEET. THESE (2) FOUND MONUMENTS WERE REPLACED WITH 2.5" BRASS DISCS STAMPED "RCE 18221 M-5" AND "RCE 18221 M-8" WITH PUNCH MARKS INSIDE NEW WELL CASINGS AS SHOWN ON 2015 RS 38 (REF. #48 THIS MAP).

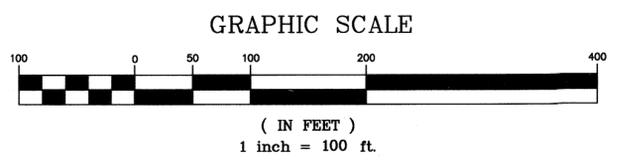

RECORD OF SURVEY
SEADRIFT ROAD & DIPSEA ROAD
MONUMENT REPLACEMENT AND CONTROL SURVEY
STINSON BEACH

MARIN COUNTY CALIFORNIA
ILS ASSOCIATES, INC.®
CIVIL ENGINEERING AND LAND SURVEYING